

# ENGINEERING POLYMERS: THE 'TOP TEN' INJECTION MOULDING PROBLEMS

R. Wilkinson, E.A. Poppe, K. Leidig and K. Schirmer



## Part 7: Poor mould surface finish

1. Moisture in the granules
2. Feed system too small
3. Wrong gate position
4. Hold time too short
5. Wrong melt temperature
6. Wrong tool temperature
7. Poor surface finish
8. Problems with hot runners
9. Warpage
10. Mould deposit

Partially crystalline engineering thermoplastics such as POM (acetal), PA (nylon), PBT and PET (polyesters) are used primarily because of their outstanding mechanical, thermal and electrical properties. Further advantages over amorphous materials include their excellent chemical resistance and low tendency towards stress cracking. In many kinds of applications a high quality surface finish is an additional requirement. This article is intended to help eliminate possible surface defects.

## Localisation and definition of surface defects

To solve the problem of surface defects one must first examine the precise location of the defect, and when it actually became evident. Here it is advisable to observe the surface during the actual injection moulding process. The points that need clarification are listed below.

- Does the defect occur with every shot or irregularly?
- Does the defect always occur in the same cavity?
- Does the defect always occur at the same place in the moulding?
- Can the defect be predicted already during a mould filling study?
- Is the defect already evident on the sprue?
- How does the defect react when a new batch of moulding compound is used?
- Does the defect occur with only one machine or with others as well?

## Analysis of possible causes of surface defects

Surface defects may be caused by many different factors such as:

- Compounding: drying, compound quality, presence of contaminants (foreign bodies)
- Injection moulding conditions: melt temperature, injection speed and change-over point
- Condition of the injection unit, e.g. wear and dead spots
- Design of the hot runner system (runners, material stoppage etc.)
- Mould design, position of gate and gate cross-section, cold slug interceptor, venting etc.
- Additives such as pigments
- The polymer contained in the moulding compound.

## Conclusions to be drawn from surface defects

### 1. Regular local defects

If surface defects regularly occur in the same place this indicates that there is a problem in the injection nozzle or the hot runner nozzle. The shape and design of the runner, gate or the moulded part itself may be responsible, e.g. sharp edges, sudden changes in wall thickness etc. Another cause may be moulding conditions such as the injection profile or the change-over point.

### 2. Irregular local defects

Where surface defects occur irregularly in different places, one should look at compounding (compound quality, presence of dust). Factors such as low melt temperature, back pressure, screw speed and screw retraction can also play an important part.

### 3. Surface defects covering large areas

This kind of defect usually extends over the entire moulding and is often visible already on the sprue. Here one should check whether melt decomposition has occurred. This is done by forcing a shot of melt into the open and observing whether, for example, it contains bubbles. In the case of hot runner systems, this method can be used with only limited success. Melt decomposition may be due to polymer degradation or decomposition of additives, caused by overheating or excessively long residence times. In the case of hygroscopic polymers, an important part is also played by hydrolytic degradation if the moulding compound has not been dried sufficiently.

## General recommendations

Parts made from partially crystalline engineering polymers should preferably not be made by hot runner injection moulding if a perfect surface finish is essential. It is advisable to make use of a subsidiary runner, which thermally isolates the nozzle from the moulded part, thereby reducing the risk of surface defects. The cold slug coming from the injection or hot runner nozzle should be intercepted by a special device opposite the sprue so that it cannot get into the moulded part.

The following table lists various surface defects and ways and means of eliminating them. In practice however, different surface defects appear simultaneously, which makes any investigation as to their origin – and their elimination – much more difficult.

Symptom	Grades	Where and when	Possible cause	Possible elimination
<b>Streaks in direction of flow</b> 	all	<ul style="list-style-type: none"> <li>with every shot across large areas</li> </ul>	<ul style="list-style-type: none"> <li>damp compound (PA)</li> <li>thermal degradation</li> </ul>	<ul style="list-style-type: none"> <li>check moisture content of compound</li> <li>check drying</li> <li>check melt temperature</li> </ul>
<b>Marbling</b> 	mineral reinforced grades	<ul style="list-style-type: none"> <li>with every shot</li> <li>behind sharp edges</li> <li>near the gate</li> </ul>	<ul style="list-style-type: none"> <li>too high shear</li> <li>slip-stick effect (outer skin migration)</li> </ul>	<ul style="list-style-type: none"> <li>reduce injection speed (possibly profile)</li> <li>round off sharp edges</li> <li>increase gate cross-section</li> </ul>
<b>Cold slug</b> 	all, especially reinforced grades	<ul style="list-style-type: none"> <li>usually occurs in only one place</li> <li>goes through the entire wall thickness</li> </ul>	<ul style="list-style-type: none"> <li>cold slug or inhomogeneous melt from the injection or hot runner nozzle has got into the moulded part</li> </ul>	<ul style="list-style-type: none"> <li>intercept cold slug</li> <li>possibly raise nozzle temperature</li> </ul>
<b>Sink mark</b> 	all, especially unreinforced grades	<ul style="list-style-type: none"> <li>opposite ribs</li> <li>near melt accumulations</li> </ul>	<ul style="list-style-type: none"> <li>greater shrinkage near melt accumulations since the holding pressure here is not effective long enough</li> </ul>	<ul style="list-style-type: none"> <li>improve design, e.g. make ribs thinner and provide uniform wall thickness</li> <li>move gate elsewhere</li> </ul>
<b>Charred surface</b> 	all	<ul style="list-style-type: none"> <li>always at the same place (near weld lines and at the end of flow paths)</li> </ul>	<ul style="list-style-type: none"> <li>oxidation through compressed air which cannot escape (Diesel effect)</li> </ul>	<ul style="list-style-type: none"> <li>provide or improve venting</li> <li>inject more slowly</li> </ul>
<b>Unmelted particles</b> 	all grades, especially unreinforced ones	<ul style="list-style-type: none"> <li>sporadically in different places</li> </ul>	<ul style="list-style-type: none"> <li>compound has not melted and is not properly homogenised</li> </ul>	<ul style="list-style-type: none"> <li>check melt temperature (perhaps too low)</li> <li>increase back pressure</li> <li>check screw speed</li> <li>possibly use bigger cylinder (longer residence time)</li> </ul>
<b>Jetting</b> 	all	<ul style="list-style-type: none"> <li>with every shot</li> <li>usually starting from the gate</li> </ul>	<ul style="list-style-type: none"> <li>jet of melt issues from the gate into the moulded part</li> <li>no flow resistance to support laminar flow</li> </ul>	<ul style="list-style-type: none"> <li>inject more slowly (possibly profile) to obtain laminar flow</li> <li>provide flow restrictor behind the gate</li> <li>possibly move gate elsewhere</li> </ul>
<b>Irregular brown spots</b> 	all	<ul style="list-style-type: none"> <li>5-15 shots are correct, then defect occurs during the next 1-2 shots, to be followed by another 5-15 good shots etc.</li> </ul>	<ul style="list-style-type: none"> <li>dead spot in nozzle or hot runner (e.g. ante-chamber). Only when the compound has degraded is it forced into the melt stream. Dead spot is then filled with fresh melt etc.</li> </ul>	<ul style="list-style-type: none"> <li>remove dead spot</li> <li>improve bypass</li> </ul>
<b>Whitish, rough surface</b> 	reinforced grades	<ul style="list-style-type: none"> <li>near the end of the flow path</li> <li>behind edges and bypasses</li> <li>near ribs</li> </ul>	<ul style="list-style-type: none"> <li>melt front stops for short time during filling</li> <li>polymer crystallises before it is forced against the wall</li> <li>glass fibres near the surface</li> </ul>	<ul style="list-style-type: none"> <li>increase injection speed</li> <li>check melt temperature, which may be too low</li> <li>check change-over point and mode (do not fill with holding pressure)</li> </ul>

## Typical surface defects and their elimination

Source: DuPont

**EUROPE/MIDDLE EAST/AFRICA**

Belgique / België  
Du Pont de Nemours (Belgium)  
Antoon Spinoystraat 6  
B-2800 Mechelen  
Tel. +32 15 44 14 11  
Telefax +32 15 44 14 09

Bulgaria  
Serviced by  
Biesterfeld Interrowa GmbH & Co. KG.  
See under Österreich.

Ceská Republika a  
Slovenská Republika  
Du Pont CZ, s.r.o.  
Pekarska 14/268  
CZ-155 00 Praha 5 – Jinonice  
Tel. +42 257 41 41 11  
Telefax +42 257 41 41 50-51

Danmark  
Du Pont Danmark ApS  
Skjøtevej 26  
P.O. Box 3000  
DK-2770 Kastrup  
Telefax +45 32 47 98 05  
Telefax +45 32 47 98 05

Deutschland  
Du Pont de Nemours  
(Deutschland) GmbH  
Du Pont Straße 1  
D-61343 Bad Homburg  
Tel. +49 6172 87 0  
Telefax +49 6172 87 27 01

Egypt  
Du Pont Products S.A.  
Bldg no. 6, Land #7, Block 1  
New Maadi  
ET-Cairo  
Tel. +202 754 65 80  
Telefax +202 516 87 81

España  
Du Pont Ibérica S.A.  
Edificio L'Ilia  
Avda. Diagonal 561  
E-08029 Barcelona  
Tel. +34 227 60 00  
Telefax +34 227 62 00

France  
DuPont de Nemours (France) SAS  
Défense Plaza  
23/25 rue Delarivière Le Foullon  
Défense 9  
92 064 La Défense Cedex  
Phone: +33 (0)1 41 97 44 00  
Telefax +33 1 47 53 09 67

Hellas  
Biesterfeld Hellas Intralink S.A.  
Trading Establishment  
149, AG, Triados Menidi Acharnes  
GR-13671 Athens  
Tel. +30 210 24 02 900  
Telefax +30 210 24 02 141

Israël  
Gadot Chemical Terminals (1985) Ltd.  
16 Habonim Street  
Netanya – South Ind. Zone  
IL-42504 Netanya  
Tel. +972 3 526 42 41  
Telefax +972 3 528 27 17

Italia  
Du Pont de Nemours Italiana S.r.L.  
Centro Direzionale "Villa Fiorita"  
Via Piero Gobetti, 2/A  
20063 Cernusco s/N (MI)  
Tel. +39 02 92629.1 (switchboard)  
Fax +39 02 36049379

Magyarország  
DuPont Magyarország Kft.  
HU - 2040 Budaörs  
Neuman J.u. 1  
Tel. +36 23 509 400  
Telefax: +36 23 509 432

Maroc  
Deborel Maroc S.A.  
40, boulevard d'Anfa – 10°  
MA-Casablanca  
Tel. +212 227 48 75  
Telefax +212 226 54 34

Norway / Norge  
Distrupol Nordic  
Ostenssloveien 36  
N-0677 Oslo  
Tel. +47 23 16 80 62  
Telefax +47 23 16 80 62

Österreich  
Biesterfeld Interrowa GmbH & Co. KG  
Bräuhausgasse 3-5  
P.O. Box 19  
AT-1051 Wien  
Tel. +43 1 512 35 71-0  
Fax +43 1 512 35 71-31  
e-mail: info@interrowa.at  
internet: www.interrowa.at

Polska  
Du Pont Poland Sp. z o.o.  
ul. Powazkowska 44C  
PL-01-797 Warsaw  
Tel. +48 22 320 0900  
Telefax +48 22 320 0910

Portugal  
Biesterfeld Iberica S.L.  
Rua das Matas  
P-4445-135 Alfena  
Tel. +351 229 698 760  
Telefax +351 229 698 769

Romania  
Serviced by  
Biesterfeld Interrowa GmbH & Co. KG.  
See under Österreich.

Russia  
DuPont Russia LLC.  
ul. Krylatskaya 17/3  
121614 Moscow  
Tel. +7 495 797 22 00  
Fax. +7 495 797 22 01

Schweiz / Suisse / Svizzera  
Biesterfeld Plastic Suisse GmbH  
Dufourstrasse 21  
Postfach 14695  
CH-4010 Basel  
Tel. +41 61 201 31 50  
Telefax +41 61 201 31 69

Slovenija  
Serviced by  
Biesterfeld Interrowa GmbH & Co. KG.  
See under Österreich.

Suomi / Finland  
Du Pont Suomi Oy  
P.O. Box 54 (Keilaranta 12)  
FI-02150 ESPOO  
Tel. +358 207 890500  
Fax: +358 207 890501

Sverige  
Serviced by  
Du Pont Danmark ApS.  
See under Danmark.

Türkiye  
Du Pont Products S.A.  
Buyukdere Caddesi No. 122  
Ozsezen Ismerkezi, A block, Kat: 3  
Esentepe, 34394 Istanbul  
Tel. +90 212 340 0400  
Telefax +90 212 340 0430

Ukraine  
Du Pont de Nemours  
International S.A.  
Representative Office  
3, Glazunova Street  
Kyiv 252042  
Tel. +380 44 294 96 33 / 269 13 02  
Telefax +380 44 269 11 81

United Kingdom  
Du Pont (UK) Limited  
Wedgwood Way  
Stevenage  
Hertfordshire SG1 4QN  
Tel. +44 1438 734000  
Telefax +44 1438 734109

South Africa  
Du Pont de Nemours  
Societe Anonyme  
South African Branch Office  
4th Floor Outspan House  
1006 Lenchen Avenue North  
Centurion  
Pretoria 0046  
Tel. +27 0 12 683 5600  
Telefax +27 0 12 683 5661

**NORTH AMERICA**

USA  
DuPont Engineering Polymers  
Barley Mill Plaza, Building 26  
P. O. Box 800026  
Wilmington, Delaware 19880  
Tel. +1 302 992 4592  
Telefax +1 302 992-6713

DuPont Automotive  
950 Stephenson Highway  
P.O. Box 7013  
Troy, MI 48007-7013  
Tel. +1 248 583-8000

Canada  
DuPont Engineering Polymers  
P.O. Box 2200  
Streetsville, Mississauga  
Ontario, Canada L5M 2H3  
Tel. +1 905 821-5953

Mexico  
DuPont S.A. de C.V.  
Homero 206  
Col. Chapultepec Morales  
11570 Mexico D.F.  
Tel. +52 555 575 221 000

**SOUTH AMERICA**

Argentina  
Du Pont Argentina S.A.  
Avda. Mitre y Calle 5  
(1884) Berazategui-Bs.As.  
Tel. +54 11 4239-3868  
Telefax +54 11 4239-3817

Brasil  
DuPont do Brasil S.A.  
Al. Itapecuru, 506 Alphaville  
06454-080 Barueri-Sao Paulo  
Tel. +5511 7266 8229

**ASIA-PACIFIC**

Australia  
DuPont (Australia) Ltd.  
168 Walker Street  
North Sydney NSW 2060  
Tel: +612 9923-6111  
Fax: +612 9923 6011

Hong Kong/China  
DuPont China Ltd.  
26/F, Tower 6, The Gateway,  
9 Canton Road  
Tsimshatsui, Kowloon, Hong Kong  
Tel: +852 2734 5345  
Fax: +852 2724 4458

Shanghai/China  
DuPont China Holding Co. Ltd.  
15/F, Shui On Plaza  
333 Huai Hai Road (Central)  
Shanghai 200021  
Tel: +86 21 6386 6366  
Fax: +86 21 6386 6333

India  
E.I. DuPont India Limited,  
"Arihant Nitco Park" Sixth floor,  
90, Dr. Radhakrishnan Salai,  
Mylapore,  
Chennai 600 004  
Tel: +91 44 28472800  
Fax: +91 44 28473800

Japan  
DuPont Kabushiki Kaisha  
Sanno Park Tower, 11-1  
Nagata-cho 2-chome  
Chiyoda-ku, Tokyo 100-6111  
Japan.  
Tel: +81 3 5521 8500  
Fax: +81 3 5521 2595

Korea  
DuPont (Korea) Ltd.  
4/5 Floor, Asia Tower  
#7/26, Yeoksam-dong, Kangnam-Ku  
Seoul 135-082  
Tel: +822 2222-5200  
Fax: +822 2222-5470

Singapore  
Du Pont Company (S) Pte Ltd  
1 HarbourFront Place #11-01  
HarbourFront Tower One  
Singapore 098633  
Tel: +65 6586 3688  
Fax: +65 6272 7494

Taiwan  
DuPont Taiwan Ltd.  
Hung Kuo Building, 13th floor  
#167 Tun Hwa North Road  
Taipei 105  
Tel: +8862 2719-1999  
Fax: +8862 2719-0852

Thailand  
DuPont (Thailand) Limited  
6-7th Floor, M. Thai Tower  
All Seasons Place  
87 Wireless Road  
Lumpini, Phatumwan  
Bangkok 10330  
Tel: +66 2 659 4000  
Fax: +66 2 659 4001

**CRASTIN® PBT**  
THERMOPLASTIC  
POLYESTER RESIN

**DELTRIN®**  
ACETAL RESIN

**HYTREL®**  
THERMOPLASTIC  
POLYESTER ELASTOMER

**MINLON®**  
MINERAL REINFORCED  
NYLON RESIN

**RYNITE® PET**  
THERMOPLASTIC  
POLYESTER RESIN

**THERMX® PCT**  
HIGH PERFORMANCE POLYESTER

**TYNEX®**  
NYLON MONOFILAMENT

**VESPEL®**  
PARTS AND SHAPES

**ZYTEL®**  
NYLON RESIN

**ZYTEL® HTN**  
HIGH PERFORMANCE  
POLYAMIDE

**ZENITE® LCP**  
LIQUID CRYSTAL POLYMER

**DUPONT® ETPV**  
THERMOPLASTIC RUBBER  
THAT RESISTS OIL & HEAT

*The DuPont Oval Logo, DuPont™, The miracles of science™, and Crastin®, Deltrin®, DuPont® ETPV, Hytrel®, Minlon®, Rynite®, Thermx®, Tynex®, Vespel®, Zytel®, Zenite® are registered trademarks or trademarks of DuPont or its affiliates.*

The information set forth herein is furnished free of charge and is based on technical data that DuPont believes to be reliable. It is intended for use by persons having technical skill at their own discretion and risk. DuPont makes no warranties, express or implied, and assumes no liability in connection with any use of this information.

©2007 E.I. du Pont de Nemours and Company



The miracles of science™