


Listed below are general processing recommendations for extruding tubing from Xtel<sup>®</sup> XE Series compounds. Please contact our technical service staff if you have additional questions.

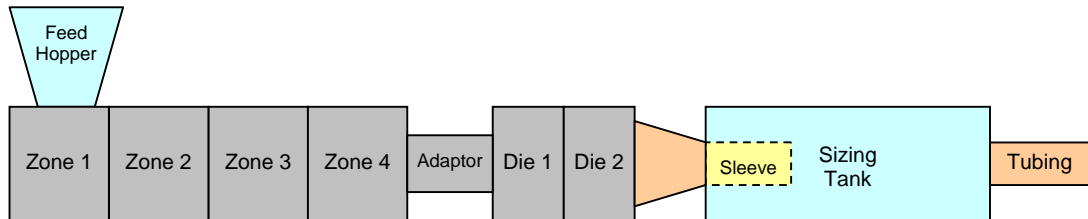

**Tube Extrusion Line Schematic**

### Extruder Set-Up

- 24:1 to 28:1 L/D
- General Purpose 2.5:1 to 3:1 compression ratio metering screw. Mixing head optional.
- 20/80/20 Screen-pack
- Rupture disk
- Heated die clamp

### Tubing Die

- Low volume, high compression die head suitable for low melt viscosity materials
- Die bushing ID should be 1.4 to 1.6 times the tubing diameter
- Die annulus 1.6 to 1.9 times the desired tubing wall thickness

### Sizing

- Short vacuum chamber sizing tank.

- Aluminum, thin wall sleeve, with 0.125-inch vacuum holes.
- Sleeve L/D = 5
- Allow for 1% to 1.5% shrinkage.
- Lube rings not required.

### Material Drying

- Dry at 275°F to 300°F (135°C to 150°C) for a minimum of 2 hours prior to processing
- Hopper driers and/or desiccant driers are not required

### Temperature Profile for Production

Extruder Zone 1	550°F (288°C)
Extruder Zone 2	570°F (300°C)
Extruder Zone 3	570°F (300°C)
Adaptor	560°F (293°C)
Die 1	560°F (293°C)
Die 2	560°F (293°C)

Before using this product, the user is advised and cautioned to make its own determination and assessment of the safety and suitability of the product for the specific use in question and is further advised against relying on the information contained herein as it may relate to any specific use or application. It is the ultimate responsibility of the user to ensure that the product is suited and the information is applicable to the user's specific application. Chevron Phillips Chemical Company LP does not make, and expressly disclaims, all warranties, including warranties of merchantability or fitness for a particular purpose, regardless of whether oral or written, express or implied, or allegedly arising from any usage of any trade or from any course of dealing in connection with the use of the information contained herein or the product itself. The user expressly assumes all risk and liability, whether based in contract, tort or otherwise, in connection with the use of the information contained herein or the product itself. Further, information contained herein is given without reference to any intellectual property issues, as well as federal, state or local laws which may be encountered in the use thereof. Such questions should be investigated by the user.

For more information and technical assistance contact:

CHEVRON PHILLIPS  
CHEMICAL COMPANY LP  
Ryton<sup>®</sup> Business Unit  
P. O. BOX 4910  
The Woodlands, TX 77387-4910  
Phone Toll Free: 1-877-798-6666  
Website: www.RytonPPS.com

Another quality product from



The Woodlands, Texas

### Processing Considerations:

Allowing sufficient extruder heating soak time on start-up is vital to ensure breaker plate and screen-packs are up to processing temperature. Cold breaker plates can result in freezing off of the extrudate at the screen-pack resulting in blocking of the extruder output and generating unacceptably high extruder pressures.

Xtel<sup>®</sup> XE Series compounds process better at higher extruder rates where the shear from the screw does more of the melting rather than the heaters. Extruders should be sized to run above 50% capacity for the process to generate sufficient shear heating while minimizing residence time.

Bubbles, smoke or gels are indications of the material being too hot for too long in the extruder. Temperatures may be adjusted as appropriate, but dies should not be set below 540°F (282°C). If melt temperatures need to be lowered, it is preferred to adjust the extruder temperature profile rather than lowering die temperatures.

Sustained melt temperatures above 600°F (315°C) for prolonged time periods can lead to thermal degradation of the compound on the screen-pack and result in unacceptably high extruder pressures.

**Purging Procedure:** Equipment used for processing Xtel<sup>®</sup> XE Series compounds is best purged at processing temperatures using a fractional melt flow HDPE (Marlex<sup>®</sup> HHM 50100). After purging with HDPE, run the extruder dry, and with the extruder and die still at temperature, break down the die and clean hot. The screw should be pulled and cleaned hot. The barrel should be cleaned hot as well.

OFF-GAS PRODUCTS PRODUCED DURING PROCESSING CAN BE IRRITANTS TO THE MUCOUS MEMBRANES, THEREFORE ADEQUATE VENTILATION IS RECOMMENDED.

Before using this product, the user is advised and cautioned to make its own determination and assessment of the safety and suitability of the product for the specific use in question and is further advised against relying on the information contained herein as it may relate to any specific use or application. It is the ultimate responsibility of the user to ensure that the product is suited and the information is applicable to the user's specific application. Chevron Phillips Chemical Company LP does not make, and expressly disclaims, all warranties, including warranties of merchantability or fitness for a particular purpose, regardless of whether oral or written, express or implied, or allegedly arising from any usage of any trade or from any course of dealing in connection with the use of the information contained herein or the product itself. The user expressly assumes all risk and liability, whether based in contract, tort or otherwise, in connection with the use of the information contained herein or the product itself. Further, information contained herein is given without reference to any intellectual property issues, as well as federal, state or local laws which may be encountered in the use thereof. Such questions should be investigated by the user.

For more information and technical assistance contact:

CHEVRON PHILLIPS  
CHEMICAL COMPANY LP  
Ryton<sup>®</sup> Business Unit  
P. O. BOX 4910  
The Woodlands, TX 77387-4910  
Phone Toll Free: 1-877-798-6666  
Website: www.RytonPPS.com

Another quality product from



The Woodlands, Texas